



TECHNICAL INFORMATION

Subject ▶ Change of Armature Ass'y


For Models ▶ GA5020C, GA5021C, GA6020C, GA6021C, PC5000C, PC5001C

Country ▶ All countries

Description ▶ For further improvement in dustproofness;
 1) Flat washer 10 has been added.
 2) Shaft of Armature ass'y has been modified.
 Ball bearing 608DDW for Armature assemblies 510126-5, 510094-2, 510147-7, 513728-6 and 518667-5 has been changed.

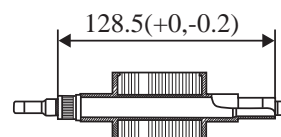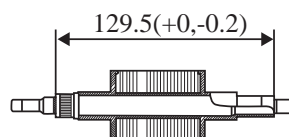

Flat washer 10 between Item No. 10 [Retaining ring (INT) R-30]
and Item No. 11 [Fan 70]

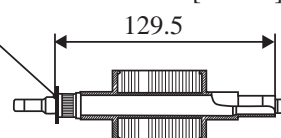

Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part	Q'ty	Note
012	Armature Ass'y 115V 513726-0		1	No	Armature Ass'y 115V 513796-9	1	Interchangeable as a set
012	Armature Ass'y 115V 510126-5		1	No	Armature Ass'y 115V 513796-9	1	
012	Armature Ass'y 240V 513729-4		1	No	Armature Ass'y 240V 513799-3	1	
012	Armature Ass'y 240V 510094-2		1	No	Armature Ass'y 240V 513799-3	1	
012	Armature Ass'y 115V 518666-7		1	No	Armature Ass'y 115V 518675-6	1	
012	Armature Ass'y 115V 510147-7		1	No	Armature Ass'y 115V 518675-6	1	
012	Armature Ass'y 220V 513728-6		1	No	Armature Ass'y 220V 513798-5	1	
012	Armature Ass'y 220V 518667-5		1	No	Armature Ass'y 220V 518676-4	1	
GA5020C, GA5021C, GA6020C, GA6021C: 061 PC5000C: 069 PC5001C: 081					Flat Washer 10 253828-7	1	
015	Ball Bearing 608DDW 210044-4		1	Yes	Ball Bearing 608DDW 210005-4	1	The component of 510126-5, 510094-2, 510147-7, 513728-6 and 518667-5 (current parts) / 513796-9, 513799-3, 518675-6, 513798-5 and 518676-4 (new parts)

Implementation

From February 2010 production